

Best Practices for Setting Up Your TRU Mixing Station



TRU Mixing Station

brought to you by



RUNYON
SURFACE PREP
RENTAL & SUPPLY

The Ideal Overlay Mixing Station Set-Up:




Equipment Needed:

- (4) CS Unitec Hippo Mixers*
- (3) CS Unitec Pelican Carts*
- (4) 1,000 lb. capacity hydraulic carts

Miscellaneous Items:




- (12) 5-gallon buckets*



- Midwest Rake gauge rakes & cams (36" for flat floor)*



- Shoe-In blunt spiked shoes*

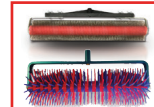

- Porcupine rollers*
(top left: for TRU & TRU Gray
bottom left: for TRU PC)



- (3) Bucket strainers*
(put inside each Pelican Cart)

Output:

- 50 - 60 bags/hr per Hippo
- 750-900 sq ft/hr per Hippo
- 3,000 sq ft/hr with (4) Hippos & (3) Pelican carts

Mixing:

- Mixing time will vary slightly...
 - Older Hippos have smaller paddles
 - Mega Hippo paddle is 15" x 9"
 - Generally, mix for 2-2.5 min after last bag added
- No straining is needed with TRU PC

- 55-gallon drums or wheeled trash cans (for mixing water)

- Digital timers
- Weather stripping
- Gorilla tape

*Denotes these items are available for purchase through Runyon Surface Prep Rental & Supply